
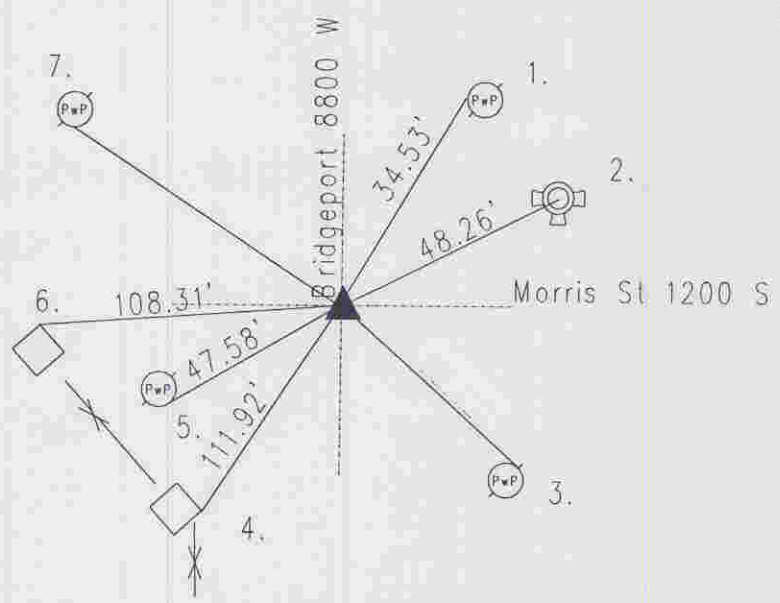


OFFICE OF THE MARION COUNTY SURVEYOR  
SECTION RECORD CORNER  
SECTION 16 TOWNSHIP 15 RANGE 2  
DATE: 10-10-01 4-18-06  
PARTY CHIEF: Wilcoxon Kiste  
CREW: \_\_\_\_\_  
TYPE OF MARKER: Harrison  
METHOD OF ESTABLISHMENT: County: 4-23-01

IN. S.P.C. E ZONE NAD '83  
NAME: 15021602  
N: 499877.5461(m)  
E: 44245.9040(m)

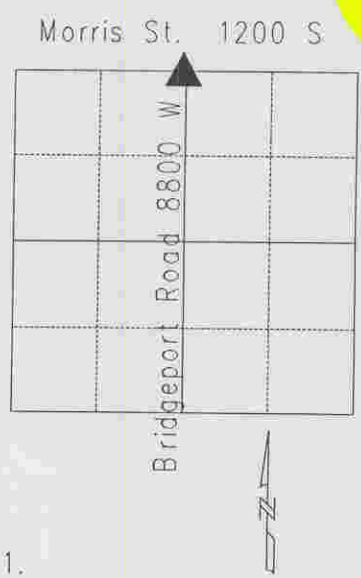

Corner originally set as a post in 1820 by Wm. B Laughlin with the following witnesses: 8" elm bearing south 20 degrees, thence west 19 links; and a 8" hackberry bearing north 29 degrees, thence east 25 links. (M.C. Atlas p.2) A survey by D. B. Hasbrook on May 6, 1853 indicates no stone but the following witness: 14" buckeye bearing north 35 degrees, thence west 44.50 links. (Wayne Legal Book p.31) A survey by Wm. P. Smith on May 18, 1869 indicates no stone but the same witnesses as previous survey. (Wayne Legal Book p. 60) Corner referenced by Miller on 7/ 29/ 77 and called a date nail 5" down. Corner referenced by Wilcoxon on 2/12/80 and called a R.R. spike. Corner referenced by Cripe Engineering on 4/1/81 and called a R.R. spike. Corner referenced by Wilcoxon on 8/28/89 and called a R.R. spike. Corner referenced by Wilcoxon on 5/17/96 and called a P.K. nail. Corner referenced by Wilcoxon on 4/23/01 and called a P. K. nail. Corner excavated by Wilcoxon 10/09/01 and a P.K. nail was found 4" down. A R.R. spike was found 6" down. A # 205 cast iron harrison monument was set in position as the corner.

15021602

REF.	DISTANCE	DESCRIPTION
1.	34.53'	Road nail W PwP#1-551 XA 2"up
2.	48.26'	Top nut of fire hydrant
3.	48.20'	PK nail E PwP#4-551 XB 8"up
4.	111.92'	Easterly corner of stone column
5.	47.58'	PK nail SE PwP#29-551 WB 6"up
6.	108.31'	Northerly corner of stone column
7.	99.49'	Road nail S PwP#13-551 WA 8"up